

CRITERION HOME INSPECTIONS

Inspection Report

New Const. Apt Punchlist

Property Address:

Carrol St BROOKLYN NY 11225



Table of Contents

Cover Page	<u>1</u>
Table of Contents	2
Intro Page	3
1 Exterior	4
2 Interiors	9
3 Heating	29
4 Air Conditioning	31
5 Plumbing System	33
6 Electrical System	37
7 Built-In Kitchen Appliances	38
Summary	40
Invoice	43
Back Page	44

Date: 6/26/2021	Time: 09:30 AM	Report ID: New Const Apt Punchlist
Property:	Customer:	Real Estate Professional:
Carrol St	New Const. Apt Punchlist	
BROOKLYN NY 11225	,	

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

<u>Inspected (IN)</u> = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

<u>Undetermined (UDT)</u> = Item condition or status could not be determined at time of inspection but may be of concern and require further investigation by others

<u>Monitor and Maintain (MM)</u> = Item may require basic or repeated maintenance and should be monitored for signs of worsening conditions and addressed as required.

Type of building:

Apartment unit

Carrol St Page 3 of 44

1. Exterior

The inspector shall inspect: The siding, flashing and trim. All exterior doors, decks, stoops, steps, stairs, porches, railings, eaves, soffits and fascias. And report as in need of repair any spacing between intermediate balusters, spindles, or rails for steps, stairways, balconies, and railings that permit the passage of an object greater than four inches in diameter. A representative number of windows. The vegetation, surface drainage and retaining walls when these are likely to adversely affect the structure. And describe the exterior wall covering.

The inspector is not required to: Inspect or operate screens, storm windows, shutters, awnings, fences, outbuildings, or exterior accent lighting, Inspect items, including window and door flashings, which are not visible or readily accessible from the ground, Inspect geological, geotechnical, hydrological and/or soil conditions, Inspect recreational facilities, playground equipment. Inspect seawalls, break-walls and docks, Inspect erosion control and earth stabilization measures, Inspect for safety type glass, Inspect underground utilities, Inspect underground items, Inspect wells or springs, Inspect solar, wind or geothermal systems, Inspect swimming pools or spas, Inspect wastewater treatment systems septic systems or cesspools, Inspect irrigation or sprinkler systems, Inspect drain fields or drywells, Determine the integrity of multi-pane window glazing or the thermal window seals.

Items

1.0 Doors

Comments: Repair or Replace, Monitor and Maintain

Rear screen door wood base threshold has not been weather sealed. This item will need properly sealed and maintained to prevent water intrusion and wood rot

Rear patio door screens have paint on them and need to be cleaned .

Patio door tracks are full of construction debris



1.0 Item 1 (Picture)

Carrol St Page 4 of 44



1.0 Item 2 (Picture)



1.0 Item 3 (Picture)


Carrol St Page 5 of 44



1.1 Decks, Balconies, Stoops, Steps, Areaways, Porches, Patio/Cover and Applicable Railings Comments: Repair or Replace, Monitor and Maintain

Carrol St Page 6 of 44

Railing is beginning to rust and is need of painting

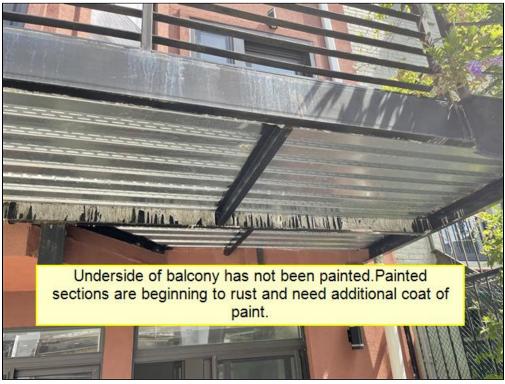

1.1 Item 1 (Picture)



1.1 Item 2 (Picture)

1.2 Patio drainage

Comments: Monitor and Maintain

Rear patio drain is poorly installed and runs under the left wall.

Carrol St Page 7 of 44

As preventative maintenance measure it is important that the patio drain is kept clean to prevent flooding



1.2 Item 1 (Picture)



1.2 Item 2 (Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 8 of 44

2. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

The inspector shall: Open and close a representative number of doors and windows. Inspect the walls, ceilings, steps, stairways, and railings. Inspect garage doors and garage door openers by operating first by remote (if available) and then by the installed automatic door control. And report as in need of repair any installed electronic sensors that are not operable or not installed at proper heights above the garage door. And report as in need of repair any door locks or side ropes that have not been removed or disabled when garage door opener is in use. And report as in need of repair any windows that are obviously fogged or display other evidence of broken seals.

The inspect or is not required to: Inspect paint, wallpaper, window treatments or finish treatments. Inspect central vacuum systems. Inspect safety glazing. Inspect security systems or components. Evaluate the fastening of countertops, cabinets, sink tops and fixtures, or firewall compromises. Move furniture, stored items, or any coverings like carpets or rugs in order to inspect the concealed floor structure. Move drop ceiling tiles. Inspect or move any household appliances. Inspect or operate equipment housed in the garage except as otherwise noted. Verify or certify safe operation of any auto reverse or related safety function of a garage door. Operate or evaluate security bar release and opening mechanisms, whether interior or exterior, including compliance with local, state, or federal standards. Operate any system, appliance or component that requires the use of special keys, codes, combinations, or devices. Operate or evaluate self-cleaning oven cycles, tilt guards/latches or signal lights. Inspect microwave ovens or test leakage from microwave ovens. Operate or examine any sauna, steam-jenny, kiln, toaster, ice-maker, coffee-maker, can-opener, bread-warmer, blender, instant hot water dispenser, or other small, ancillary devices. Inspect elevators. Inspect remote controls. Inspect appliances. Inspect items not permanently installed. Examine or operate any above-ground, movable, freestanding, or otherwise non-permanently installed pool/spa, recreational equipment or self-contained equipment. Come into contact with any pool or spa water in order to determine the system structure or components. Determine the adequacy of spa jet water force or bubble effect. Determine the structural integrity or leakage of a pool or spa.

Items

2.0 Ceilings and Walls

Comments: Repair or Replace

Carrol St Page 9 of 44

Window niche wall surfaces have excess plaster and paint splatters

Unfinished edge at kitchen window

Bedroom wall and ceiling near rear door is water damaged and currently has an elevated moisture content.

Plaster tape crack at ceiling in living room area





2.0 Item 1 (Picture)


2.0 Item 2 (Picture)

Carrol St Page 10 of 44



2.0 Item 3 (Picture)

Carrol St Page 11 of 44

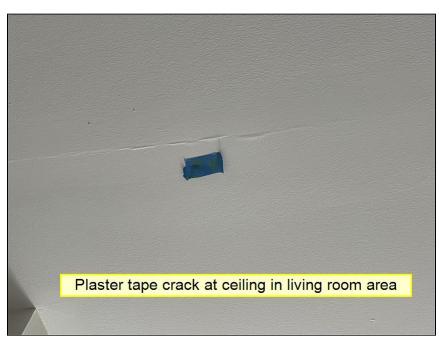

2.0 Item 4 (Picture)



Carrol St Page 12 of 44





2.0 Item 7 (Picture)

2.0 Item 8 (Picture)

2.1 Floors

Comments: Repair or Replace

Floors are in need of general cleaning of excess construction debris/ residue.

2.2 Kitchen cabinets and counters

Comments: Repair or Replace

Carrol St Page 13 of 44

Open seams at edge of cabinets and backsplash

Countertop stains

Open gap at underside corner of kitchen cabinets






2.2 Item 1 (Picture)

2.2 Item 2 (Picture)

Carrol St Page 14 of 44

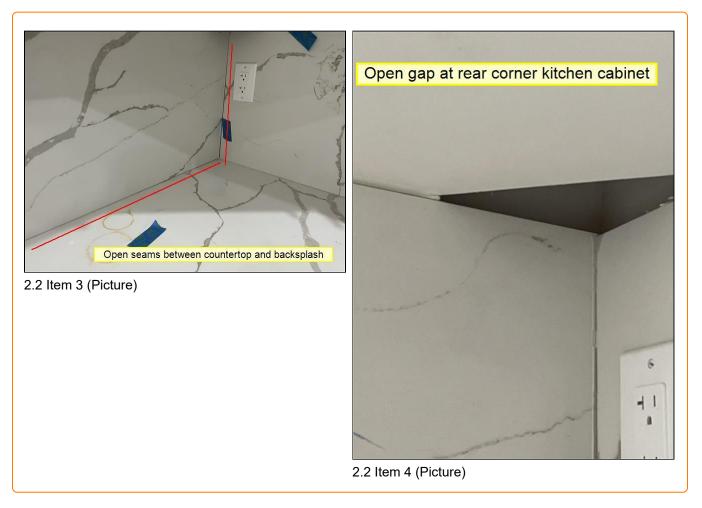

2.3 Bathroom Millwork, Medicine Cabinets

Comments: Inspected

2.4 Doors, and Hardware

Comments: Inspected

2.5 Windows (representative number)

Comments: Inspected

2.6 Moldings


Comments: Repair or Replace

Carrol St Page 15 of 44

Base molding at entry is damaged and saturated, This due from a pipe burst in adjoining building utility room

Several sections of moldings throughout have Incomplete / substandard finishes.

Open gaps between base molding and flooring throughout

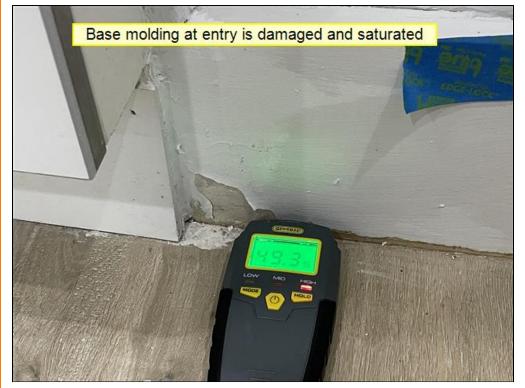

2.6 Item 1 (Picture)

Carrol St Page 16 of 44




2.6 Item 2 (Picture)



2.6 Item 3 (Picture)

Carrol St Page 17 of 44

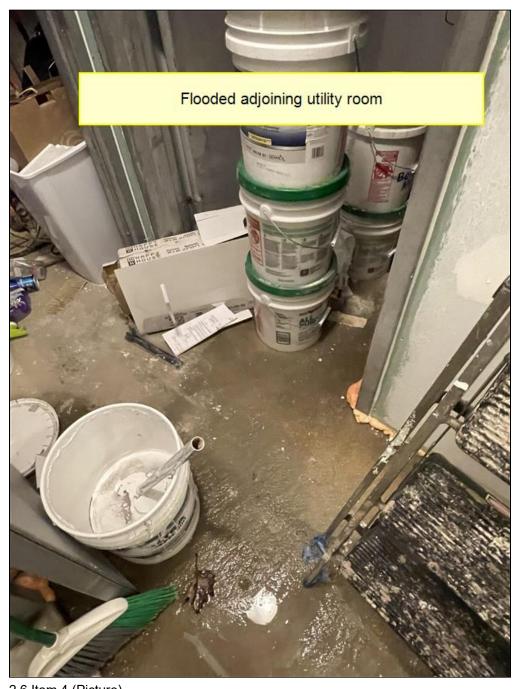

2.6 Item 4 (Picture)

Carrol St Page 18 of 44



2.6 Item 5 (Picture)

Carrol St Page 19 of 44



2.6 Item 6 (Picture)


Carrol St Page 20 of 44



Carrol St Page 21 of 44




2.6 Item 8 (Picture)

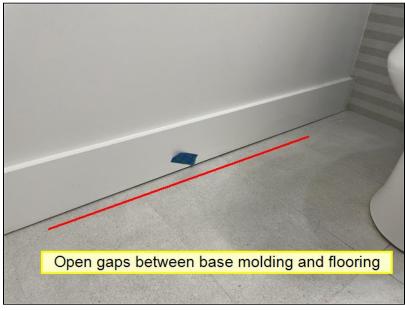

2.6 Item 9 (Picture)

Carrol St Page 22 of 44

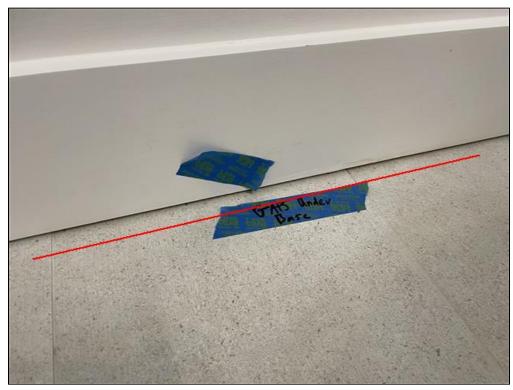

2.6 Item 10 (Picture)



2.6 Item 11 (Picture)

Carrol St Page 23 of 44



Carrol St Page 24 of 44



2.6 Item 13 (Picture)

Carrol St Page 25 of 44




2.6 Item 14 (Picture)



2.6 Item 15 (Picture)


Carrol St Page 26 of 44

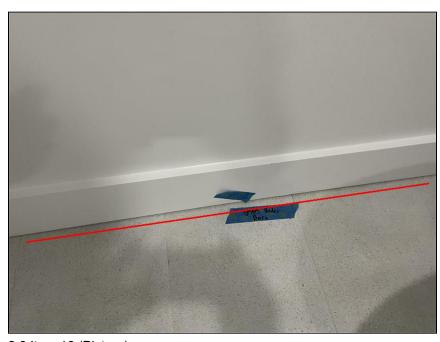

2.6 Item 16 (Picture)

2.7 Hallway entry clsoet below stairs

Comments: Not Present

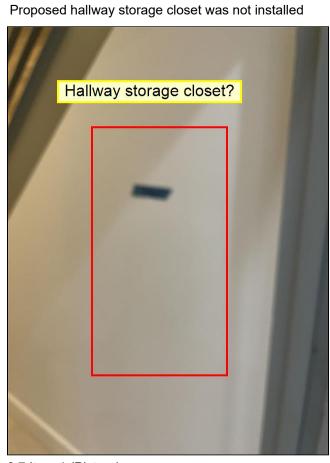

2.7 Item 1 (Picture)

Carrol St Page 27 of 44

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 28 of 44

3. Heating

The inspector shall inspect: The heating system and describe the energy source and heating method using normal operating controls. And report as in need of repair electric furnaces which do not operate. And report if inspector deemed the furnace inaccessible. The central cooling equipment using normal operating controls. The fireplace, and open and close the damper door if readily accessible and operable. Hearth extensions and other permanently installed components. And report as in need of repair deficiencies in the lintel, hearth and material surrounding the fireplace, including clearance from combustible materials.

The inspector is not required to: Inspect or evaluate interiors of flues or chimneys, fire chambers, heat exchangers, humidifiers, dehumidifiers, electronic air filters, solar heating systems, solar heating systems or fuel tanks. Inspect underground fuel tanks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system. Light or ignite pilot flames. Activate heating, heat pump systems, or other heating systems when ambient temperatures or when other circumstances are not conducive to safe operation or may damage the equipment. Override electronic thermostats. Evaluate fuel quality. Verify thermostat calibration, heat anticipation or automatic setbacks, timers, programs or clocks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the cooling system. Inspect window units, through-wall units, or electronic air filters. Operate equipment or systems if exterior temperature is below 60 degrees Fahrenheit or when other circumstances are not conducive to safe operation or may damage the equipment. Inspect or determine thermostat calibration, heat anticipation or automatic setbacks or clocks. Examine electrical current, coolant fluids or gasses, or coolant leakage. Inspect the flue or vent system. Inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels. Determine the need for a chimney sweep. Operate gas fireplace inserts. Light pilot flames. Determine the appropriateness of such installation. Inspect automatic fuel feed devices. Inspect combustion and/or make-up air devices. Inspect heat distribution assists whether gravity controlled or fan assisted. Ignite or extinguish fires. Determine draft characteristics. Move fireplace inserts, stoves, or firebox contents. Determine adequacy of draft, perform a smoke test or dismantle or remove any component. Perform an NFPA inspection. Perform a Phase 1 fireplace and chimney inspection.

Styles & Materials

Heat Type: Energy Source:

Split system heat and A/C Electric

Items

3.0 Heating

Comments: Not Inspected

Carrol St Page 29 of 44

Thermostat/ controls were not installed and unit could not be tested



3.0 Item 1 (Picture)

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 30 of 44

4. Air Conditioning

The inspector shall inspect: The heating system and describe the energy source and heating method using normal operating controls. And report as in need of repair electric furnaces which do not operate. And report if inspector deemed the furnace inaccessible. The central cooling equipment using normal operating controls. The fireplace, and open and close the damper door if readily accessible and operable. Hearth extensions and other permanently installed components. And report as in need of repair deficiencies in the lintel, hearth and material surrounding the fireplace, including clearance from combustible materials.

The inspector is not required to: Inspect or evaluate interiors of flues or chimneys, fire chambers, heat exchangers, humidifiers, dehumidifiers, electronic air filters, solar heating systems, solar heating systems or fuel tanks. Inspect underground fuel tanks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system. Light or ignite pilot flames. Activate heating, heat pump systems, or other heating systems when ambient temperatures or when other circumstances are not conducive to safe operation or may damage the equipment. Override electronic thermostats. Evaluate fuel quality. Verify thermostat calibration, heat anticipation or automatic setbacks, timers, programs or clocks. Determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the cooling system. Inspect window units, through-wall units, or electronic air filters. Operate equipment or systems if exterior temperature is below 60 degrees Fahrenheit or when other circumstances are not conducive to safe operation or may damage the equipment. Inspect or determine thermostat calibration, heat anticipation or automatic setbacks or clocks. Examine electrical current, coolant fluids or gasses, or coolant leakage. Inspect the flue or vent system. Inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels. Determine the need for a chimney sweep. Operate gas fireplace inserts. Light pilot flames. Determine the appropriateness of such installation. Inspect automatic fuel feed devices. Inspect combustion and/or make-up air devices. Inspect heat distribution assists whether gravity controlled or fan assisted. Ignite or extinguish fires. Determine draft characteristics. Move fireplace inserts, stoves, or firebox contents. Determine adequacy of draft, perform a smoke test or dismantle or remove any component. Perform an NFPA inspection. Perform a Phase 1 fireplace and chimney inspection.

Styles & Materials

Cooling Equipment Type:

Split system AC /Heat

Items

4.0 Air conditioning

Comments: Not Inspected

Thermostat/ controls were not installed and unit could not be tested

4.1 Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

Comments: Not Present

Thermostat/ controls were not installed and unit could not be tested



4.1 Item 1 (Picture)

Carrol St Page 31 of 44

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 32 of 44

5. Plumbing System

The inspector shall: Verify the presence of and identify the location of the main water shutoff valve. Inspect the water heating equipment, including combustion air, venting, connections, energy sources, seismic bracing, and verify the presence or absence of temperature-pressure relief valves and/ or Watts 210 valves. Flush toilets. Run water in sinks, tubs, and showers. Inspect the interior water supply including all fixtures and faucets. Inspect the drain, waste and vent systems, including all fixtures. Describe any visible fuel storage systems. Inspect the drainage sump pumps testing sumps with accessible floats. Inspect and describe the water supply, drain, waste and main fuel shut-off valves, as well as the location of the water main and main fuel shut-off valves. Inspect and determine if the water supply is public or private. Inspect and report as in need of repair deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously. Inspect and report as in need of repair deficiencies in installation and identification of hot and cold faucets. Inspect and report as in need of repair mechanical drain-stops that are missing or do not operate if installed in sinks, lavatories and tubs. Inspect and report as in need of repair commodes that have cracks in the ceramic material, are improperly mounted on the floor, leak, or have tank components which do not operate.

The inspector is not required to: Light or ignite pilot flames. Determine the size, temperature, age, life expectancy or adequacy of the water heater. Inspect interiors of flues or chimneys, water softening or filtering systems, well pumps or tanks, safety or shut-of valves, floor drains, lawn sprinkler systems or fire sprinkler systems. Determine the exact flow rate, volume, pressure, temperature, or adequacy of the water supply. Determine the water quality or potability or the reliability of the water supply or source. Open sealed plumbing access panels. Inspect clothes washing machines or their connections. Operate any main, branch or fixture valve. Test shower pans, tub and shower surrounds or enclosures for leakage. Evaluate the compliance with local or state conservation or energy standards, or the proper design or sizing of any water, waste or venting components, fixtures or piping. Determine the effectiveness of anti-siphon, back-flow prevention or drain-stop devices. Determine whether there are sufficient clean-outs for effective cleaning of drains. Evaluate gas, liquid propane or oil storage tanks. Inspect any private sewage waste disposal system or component of. Inspect water treatment systems or water filters. Inspect water storage tanks, pressure pumps or bladder tanks. Evaluate time to obtain hot water at fixtures, or perform testing of any kind to water heater elements. Evaluate or determine the adequacy of combustion air. Test, operate, open or close safety controls, manual stop valves and/or temperature or pressure relief valves. Examine ancillary systems or components, such as, but not limited to, those relating to solar water heating, hot water circulation.

Items

5.0 Plumbing water supply

Comments: Inspected

5.1 Plumbing drainage system

Comments: Inspected

5.2 Plumbing fixtures, tub, sink toilet

Comments: Not Present, Repair or Replace

Carrol St Page 33 of 44

Toilet is not well secured to the floor


Porcelain tub glaze is chipped

Bathtub does not have a water spout



5.2 Item 1 (Picture)

Carrol St Page 34 of 44

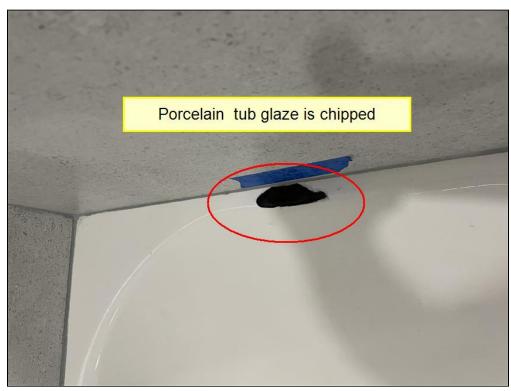

5.2 Item 2 (Picture)



5.2 Item 3 (Picture)

5.3 Hot water supply

Comments: Not Present

Carrol St Page 35 of 44

Punchlist

Hot water was not on at the time of inspection

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 36 of 44

6. Electrical System

The inspector shall inspect: The service line. The meter box. The main disconnect. And determine the rating of the service amperage. Panels, breakers and fuses. The service grounding and bonding. A representative sampling of switches, receptacles, light fixtures, AFCI receptacles and test all GFCI receptacles and GFCI circuit breakers observed and deemed to be GFCI's during the inspection. And report the presence of solid conductor aluminum branch circuit wiring if readily visible. And report on any GFCI-tested receptacles in which power is not present, polarity is incorrect, the receptacle is not grounded, is not secured to the wall, the cover is not in place, the ground fault circuit interrupter devices are not properly installed or do not operate properly, or evidence of arcing or excessive heat is present. The service entrance conductors and the condition of their sheathing. The ground fault circuit interrupters observed and deemed to be GFCI's during the inspection with a GFCI tester. And describe the amperage rating of the service. And report the absence of smoke detectors. Service entrance cables and report as in need of repair deficiencies in the integrity of the insulation, drip loop, or separation of conductors at weatherheads and clearances.

The inspector is not required to: Insert any tool, probe or device into the main panel, sub-panels, downstream panel, or electrical fixtures. Operate electrical systems that are shut down. Remove panel covers or dead front covers if not readily accessible. Operate over current protection devices. Operate non-accessible smoke detectors. Measure or determine the amperage or voltage of the main service if not visibly labeled. Inspect the alarm system and components. Inspect the ancillary wiring or remote control devices. Activate any electrical systems or branch circuits which are not energized. Operate overload devices. Inspect low voltage systems, electrical de-icing tapes, swimming pool wiring or any time-controlled devices. Verify the continuity of the connected service ground. Inspect private or emergency electrical supply sources, including but not limited to generators, windmills, photovoltaic solar collectors, or battery or electrical storage facility. Inspect spark or lightning arrestors. Conduct voltage drop calculations. Determine the accuracy of breaker labeling. Inspect exterior lighting.

Items

6.0 Switches and lighting

Comments: Inspected

6.1 Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels

Comments: Inspected

6.2 Branch Circuit Conductors, Compatability of their Amperage and Voltage

Comments: Inspected

6.3 Connected Devices and Fixtures.

Comments: Inspected

6.4 Polarity and Grounding of Receptacles.

Comments: Inspected

6.5 Operation of GFCI (Ground Fault Circuit Interrupters)

Comments: Inspected

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 37 of 44

7. Built-In Kitchen Appliances

Items

7.0 Dishwasher

Comments: Not Inspected

Dishwasher was not on

7.1 Ranges/Ovens/Cooktops

Comments: Repair or Replace

Stove was not lighting




7.1 Item 1 (Picture)

7.2 Range Hood (s)

Comments: Not Present

Carrol St Page 38 of 44

Range hood was not installed

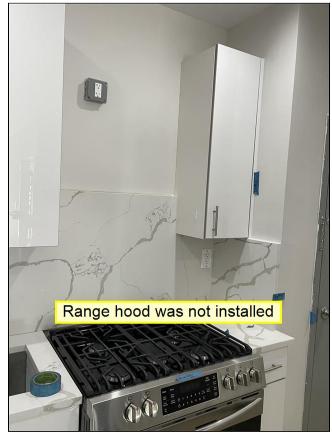

7.2 Item 1 (Picture)

7.3 Refrigerator

Comments: Not Inspected

Refrigerator was not on

7.4 Washing machine and Dryer

Comments: Not Inspected

Washing machine was not on

7.5 Microwave

Comments: Not Present

Microwave was not installed

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Carrol St Page 39 of 44

Summary



Criterion Home Inspections

CRITERION HOME INSPECTIONS

Customer

New Const. Apt Punchlist

Address

Carrol St BROOKLYN NY 11225

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Exterior

1.0 Doors

Repair or Replace, Monitor and Maintain

Rear screen door wood base threshold has not been weather sealed. This item will need properly sealed and maintained to prevent water intrusion and wood rot

Rear patio door screens have paint on them and need to be cleaned.

Patio door tracks are full of construction debris

1.1 Decks, Balconies, Stoops, Steps, Areaways, Porches, Patio/Cover and Applicable Railings

Repair or Replace, Monitor and Maintain

Railing is beginning to rust and is need of painting

2. Interiors

2.0 Ceilings and Walls

Repair or Replace

Window niche wall surfaces have excess plaster and paint splatters

Carrol St Page 40 of 44

Unfinished edge at kitchen window

Bedroom wall and ceiling near rear door is water damaged and currently has an elevated moisture content.

Plaster tape crack at ceiling in living room area

2.1 Floors

Repair or Replace

Floors are in need of general cleaning of excess construction debris/ residue.

2.2 Kitchen cabinets and counters

Repair or Replace

Open seams at edge of cabinets and backsplash

Countertop stains

Open gap at underside corner of kitchen cabinets

2.6 Moldings

Repair or Replace

Base molding at entry is damaged and saturated, This due from a pipe burst in adjoining building utility room

Several sections of moldings throughout have Incomplete / substandard finishes.

Open gaps between base molding and flooring throughout

5. Plumbing System

5.2 Plumbing fixtures, tub, sink toilet

Not Present, Repair or Replace

Toilet is not well secured to the floor

Porcelain tub glaze is chipped

Bathtub does not have a water spout

7. Built-In Kitchen Appliances

7.1 Ranges/Ovens/Cooktops

Repair or Replace

Stove was not lighting

Carrol St Page 41 of 44

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Ralph Hassard

Carrol St Page 42 of 44



INVOICE

Criterion Home Inspections
CRITERION HOME INSPECTIONS
Inspected By: Ralph Hassard

Inspection Date: 6/26/2021 Report ID: New Const Apt Punchlist

Customer Info:	Inspection Property:
New Const. Apt Punchlist	Carrol St BROOKLYN NY 11225
Customer's Real Estate Professional:	

Inspection Fee:

Service Price Amount Sub-Total

Tax \$0.00

Total Price \$0.00

Payment Method: Payment Status:

Note:

Carrol St Page 43 of 44



Criterion Home Inspections

Ralph Hassard

CRITERION HOME INSPECTIONS



Carrol St Page 44 of 44